



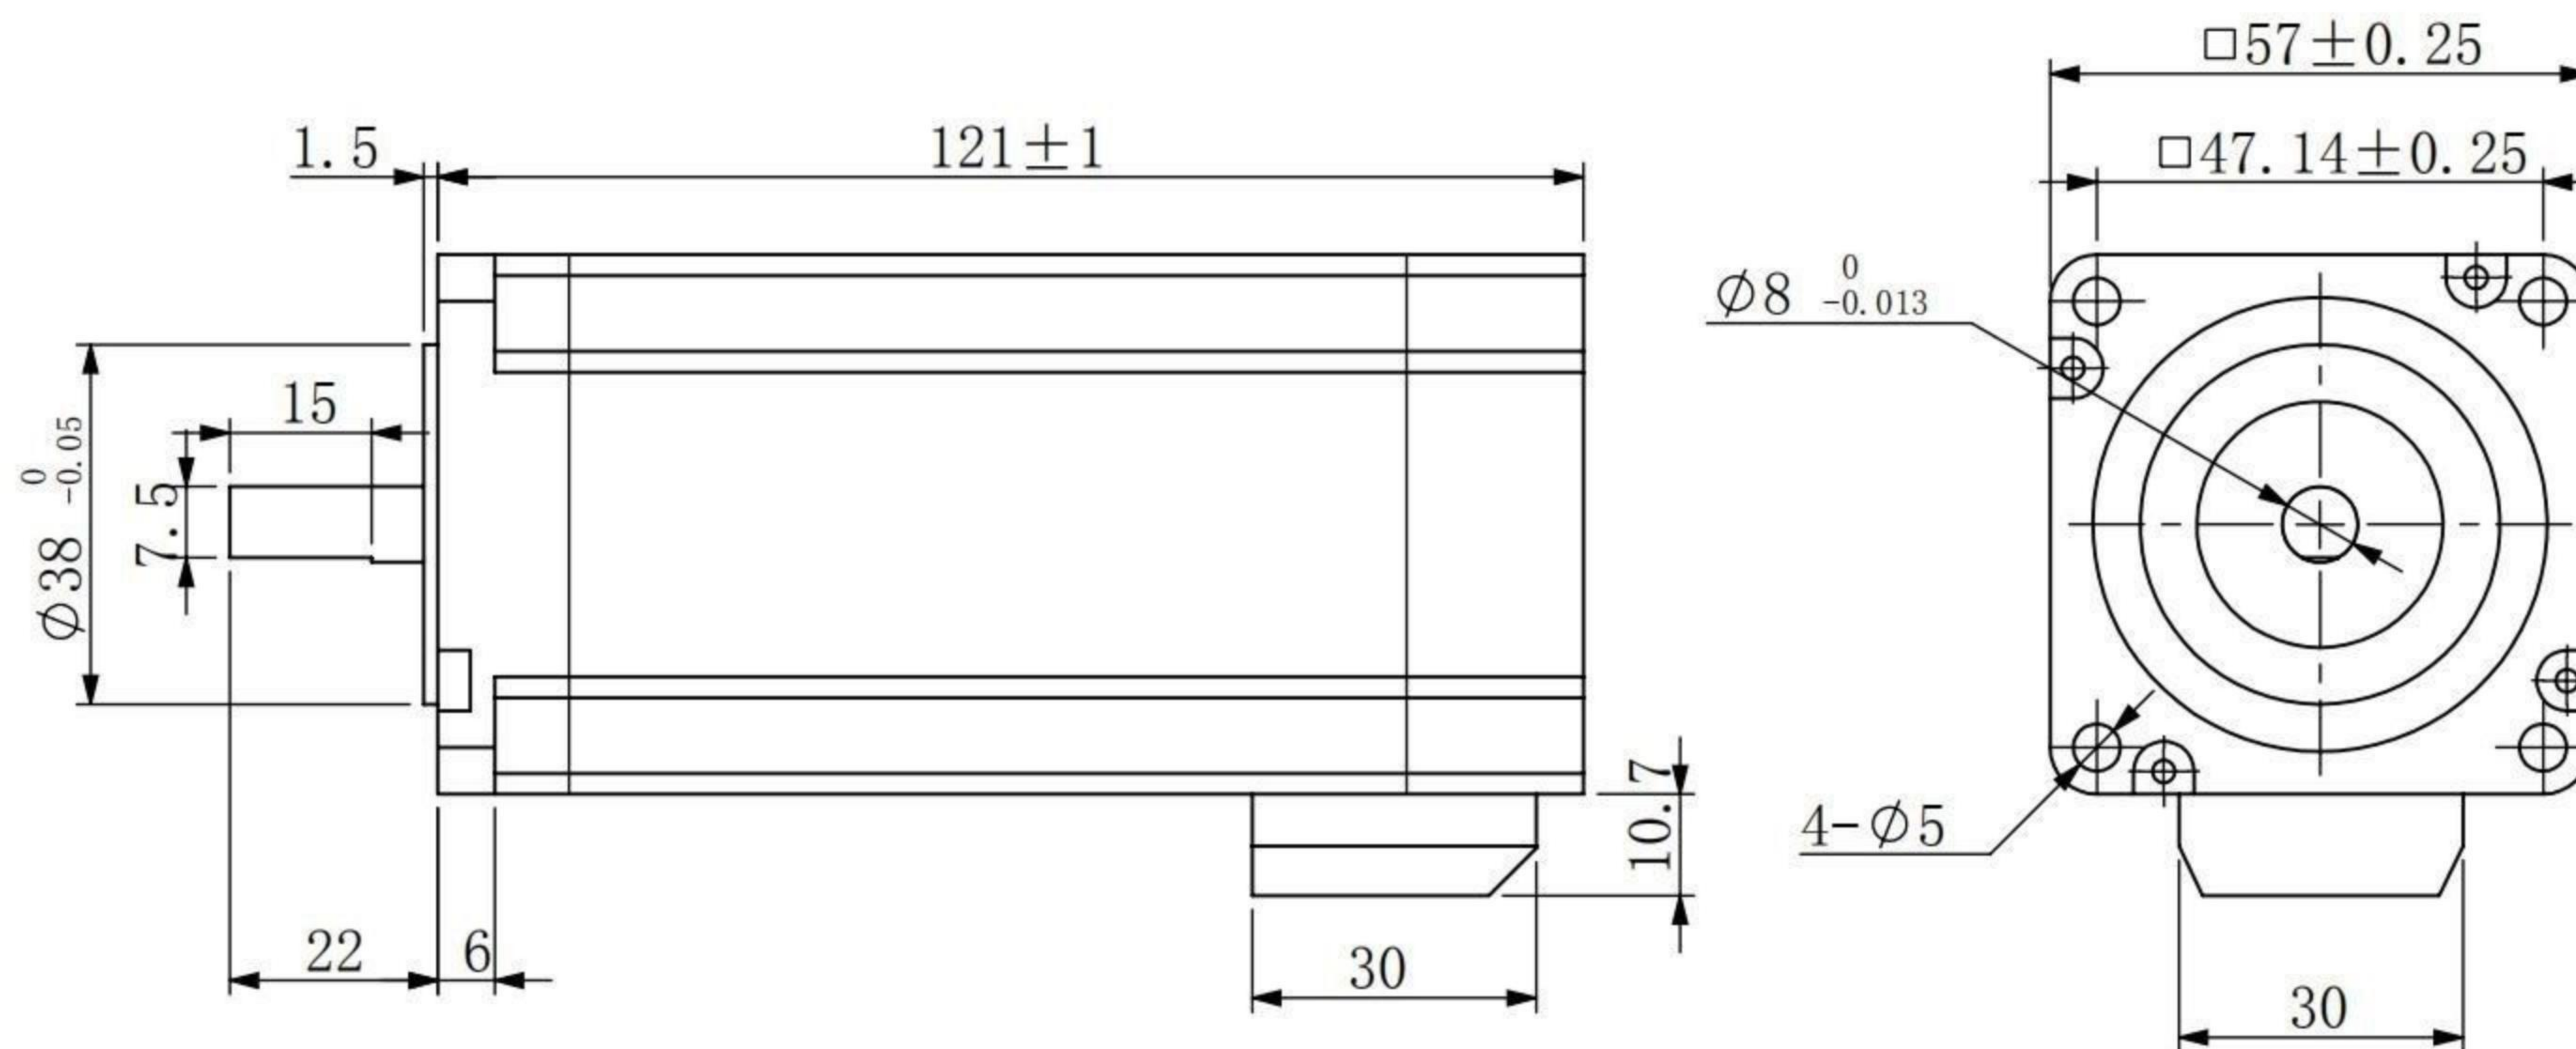

励磁顺序 (2相励磁)
Phase Sequence (2Phase Exciting)


step	A	B	A-	B-
1	+	+	-	-
2	-	+	+	-
3	-	-	+	+
4	+	-	-	+

↑CCW
CW→

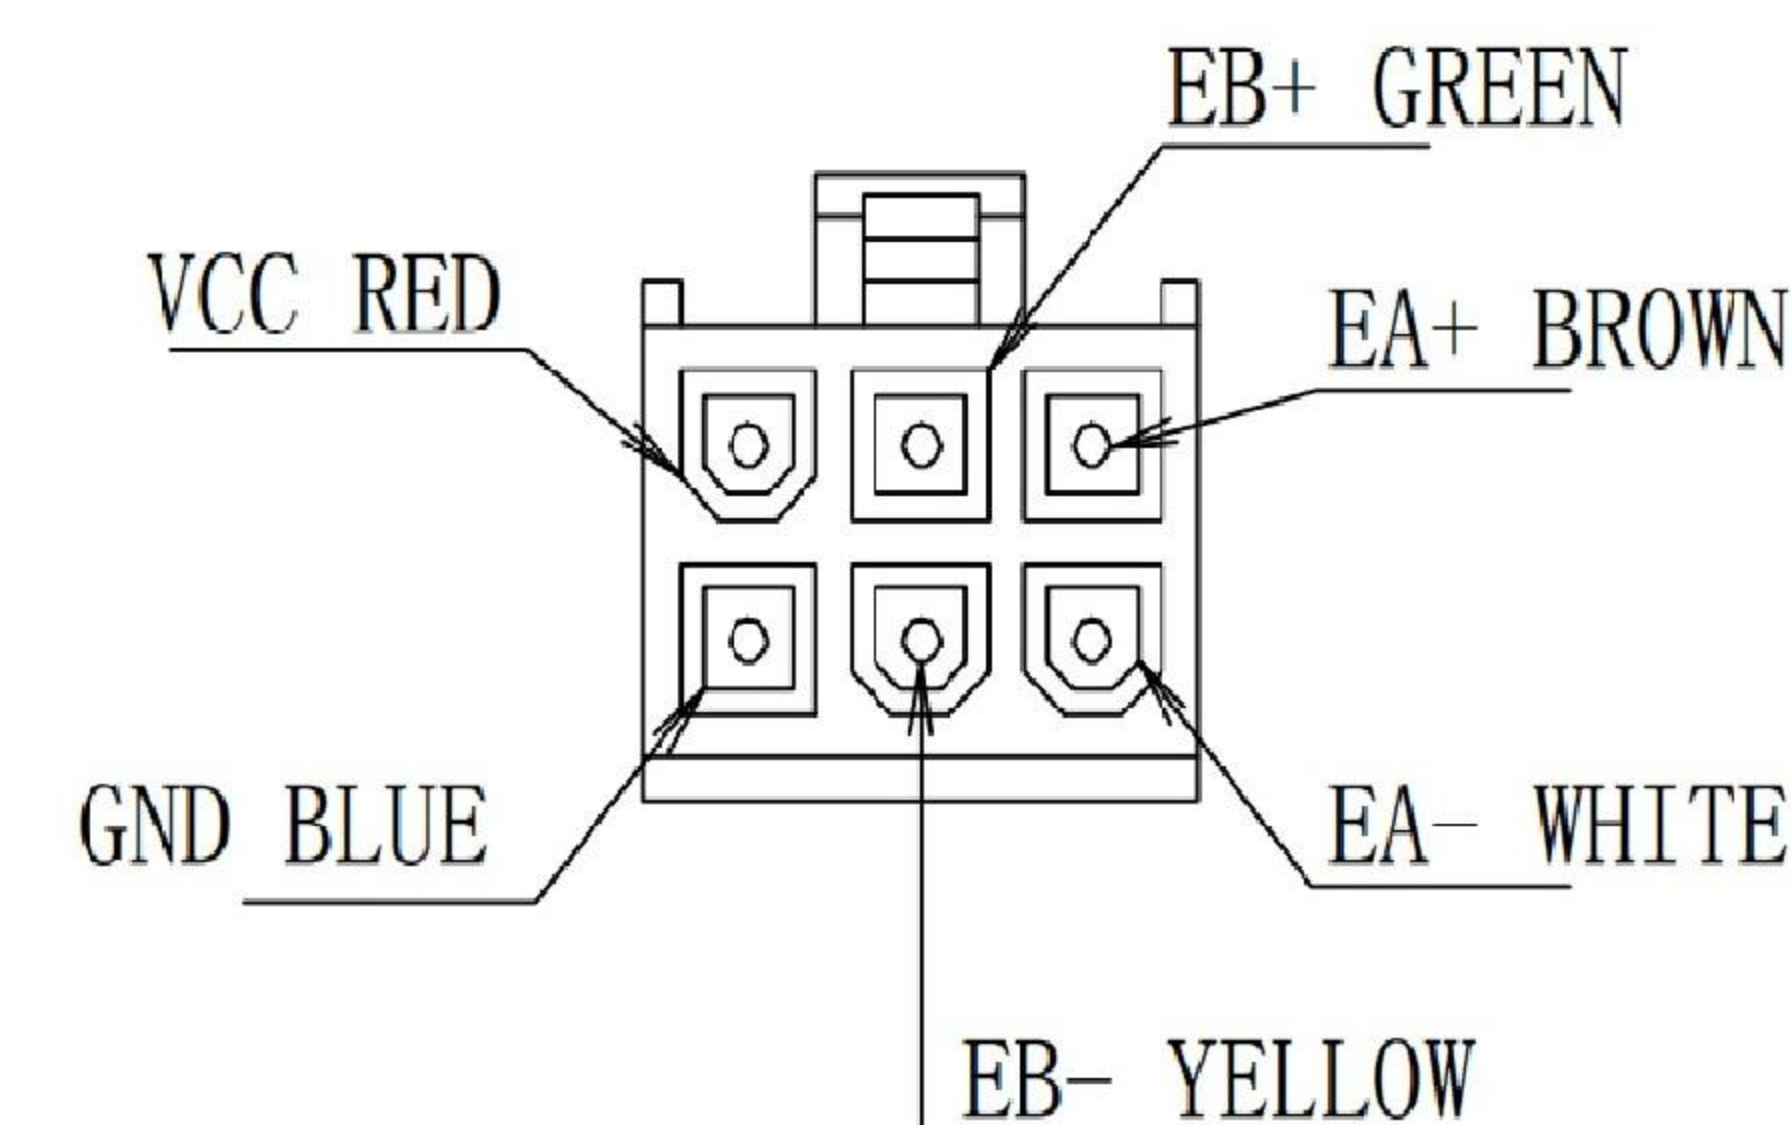

Phase	2	Voltage resistance	500VAC/min
Step angle	1.8°	Insulation resistance	100MΩ/min
Torque	3.0NM	Radial runout	0.06Max (450g-load)
Current	5.0A	Axial runout	0.08Max (450g-load)
Phase inductance	3.7mH	Temperature rise	80°C Max
Phase resistance	0.82Ohm	Ambient Temperature	-10°C~+50°C
Rotor inertia	720g.cm ²	Insulation class	class B

接线图/Wiring Diagram

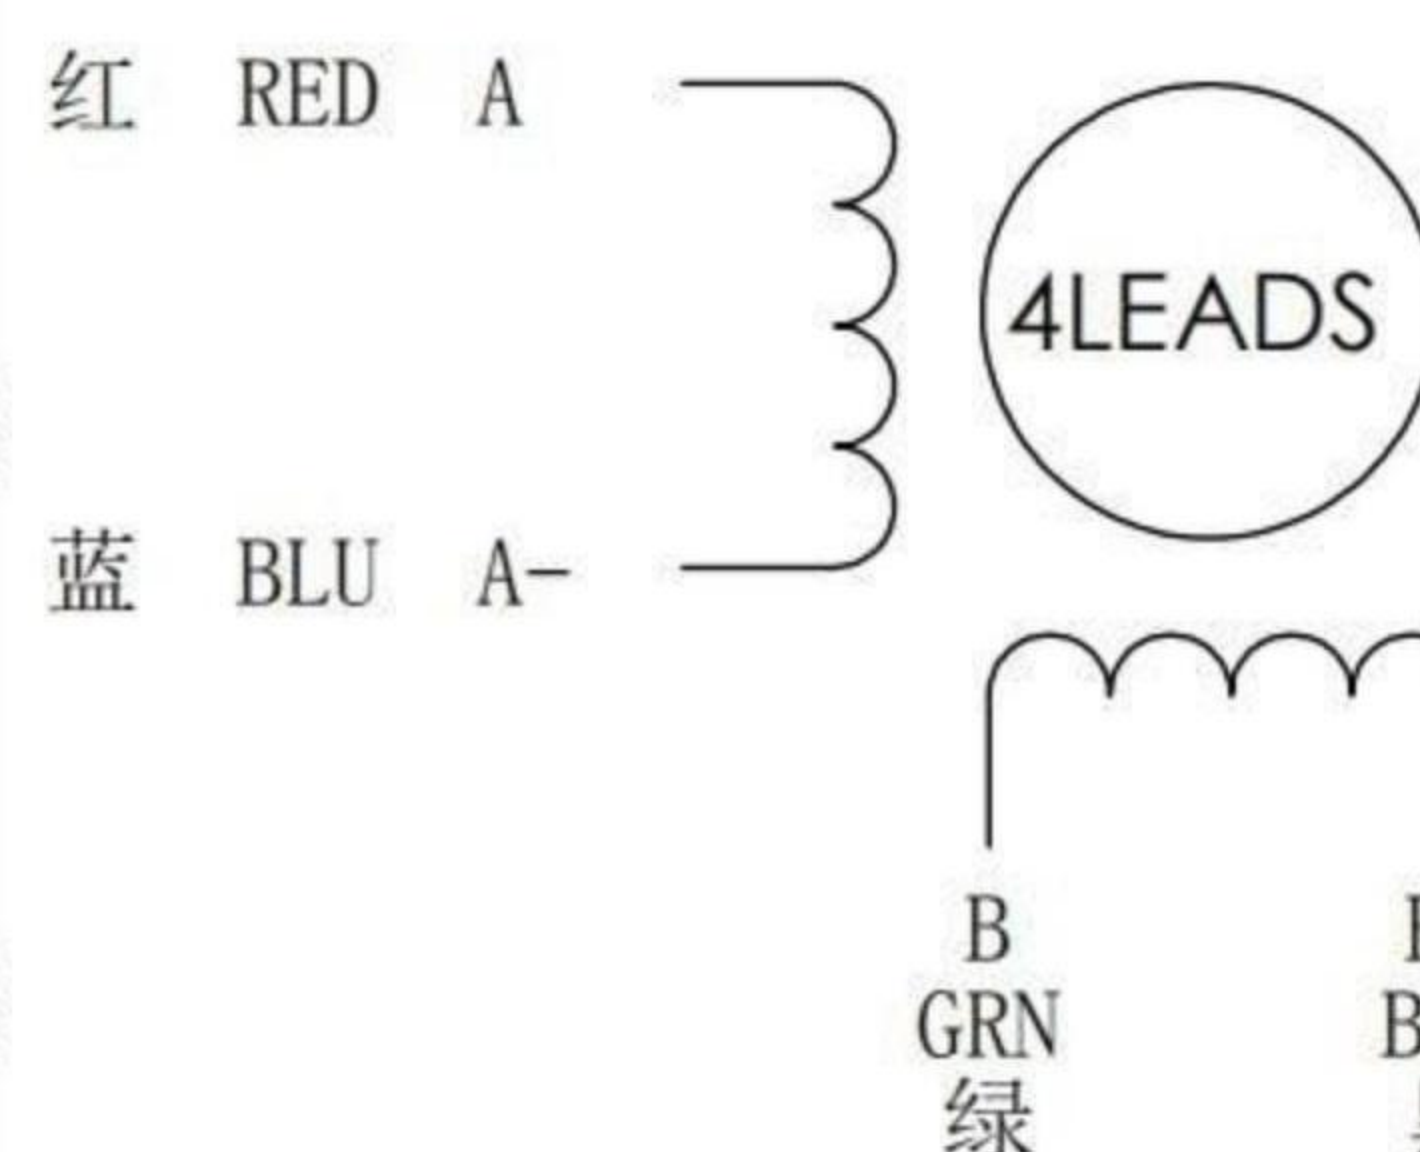

电机引线颜色 Lead Color	棕 BRN	白 WHT	绿 GRN	黄 YEL	红 RED	蓝 BLU	分辨率
信号 Signal	EA+	EA-	EB+	EB-	VCC (+5V)	GND	4000ppr

标题:

深圳锐特机电技术有限公司

工程图号

57A30EC

修订

比例: 2:3

单位: mm

图纸 1 (共1)