



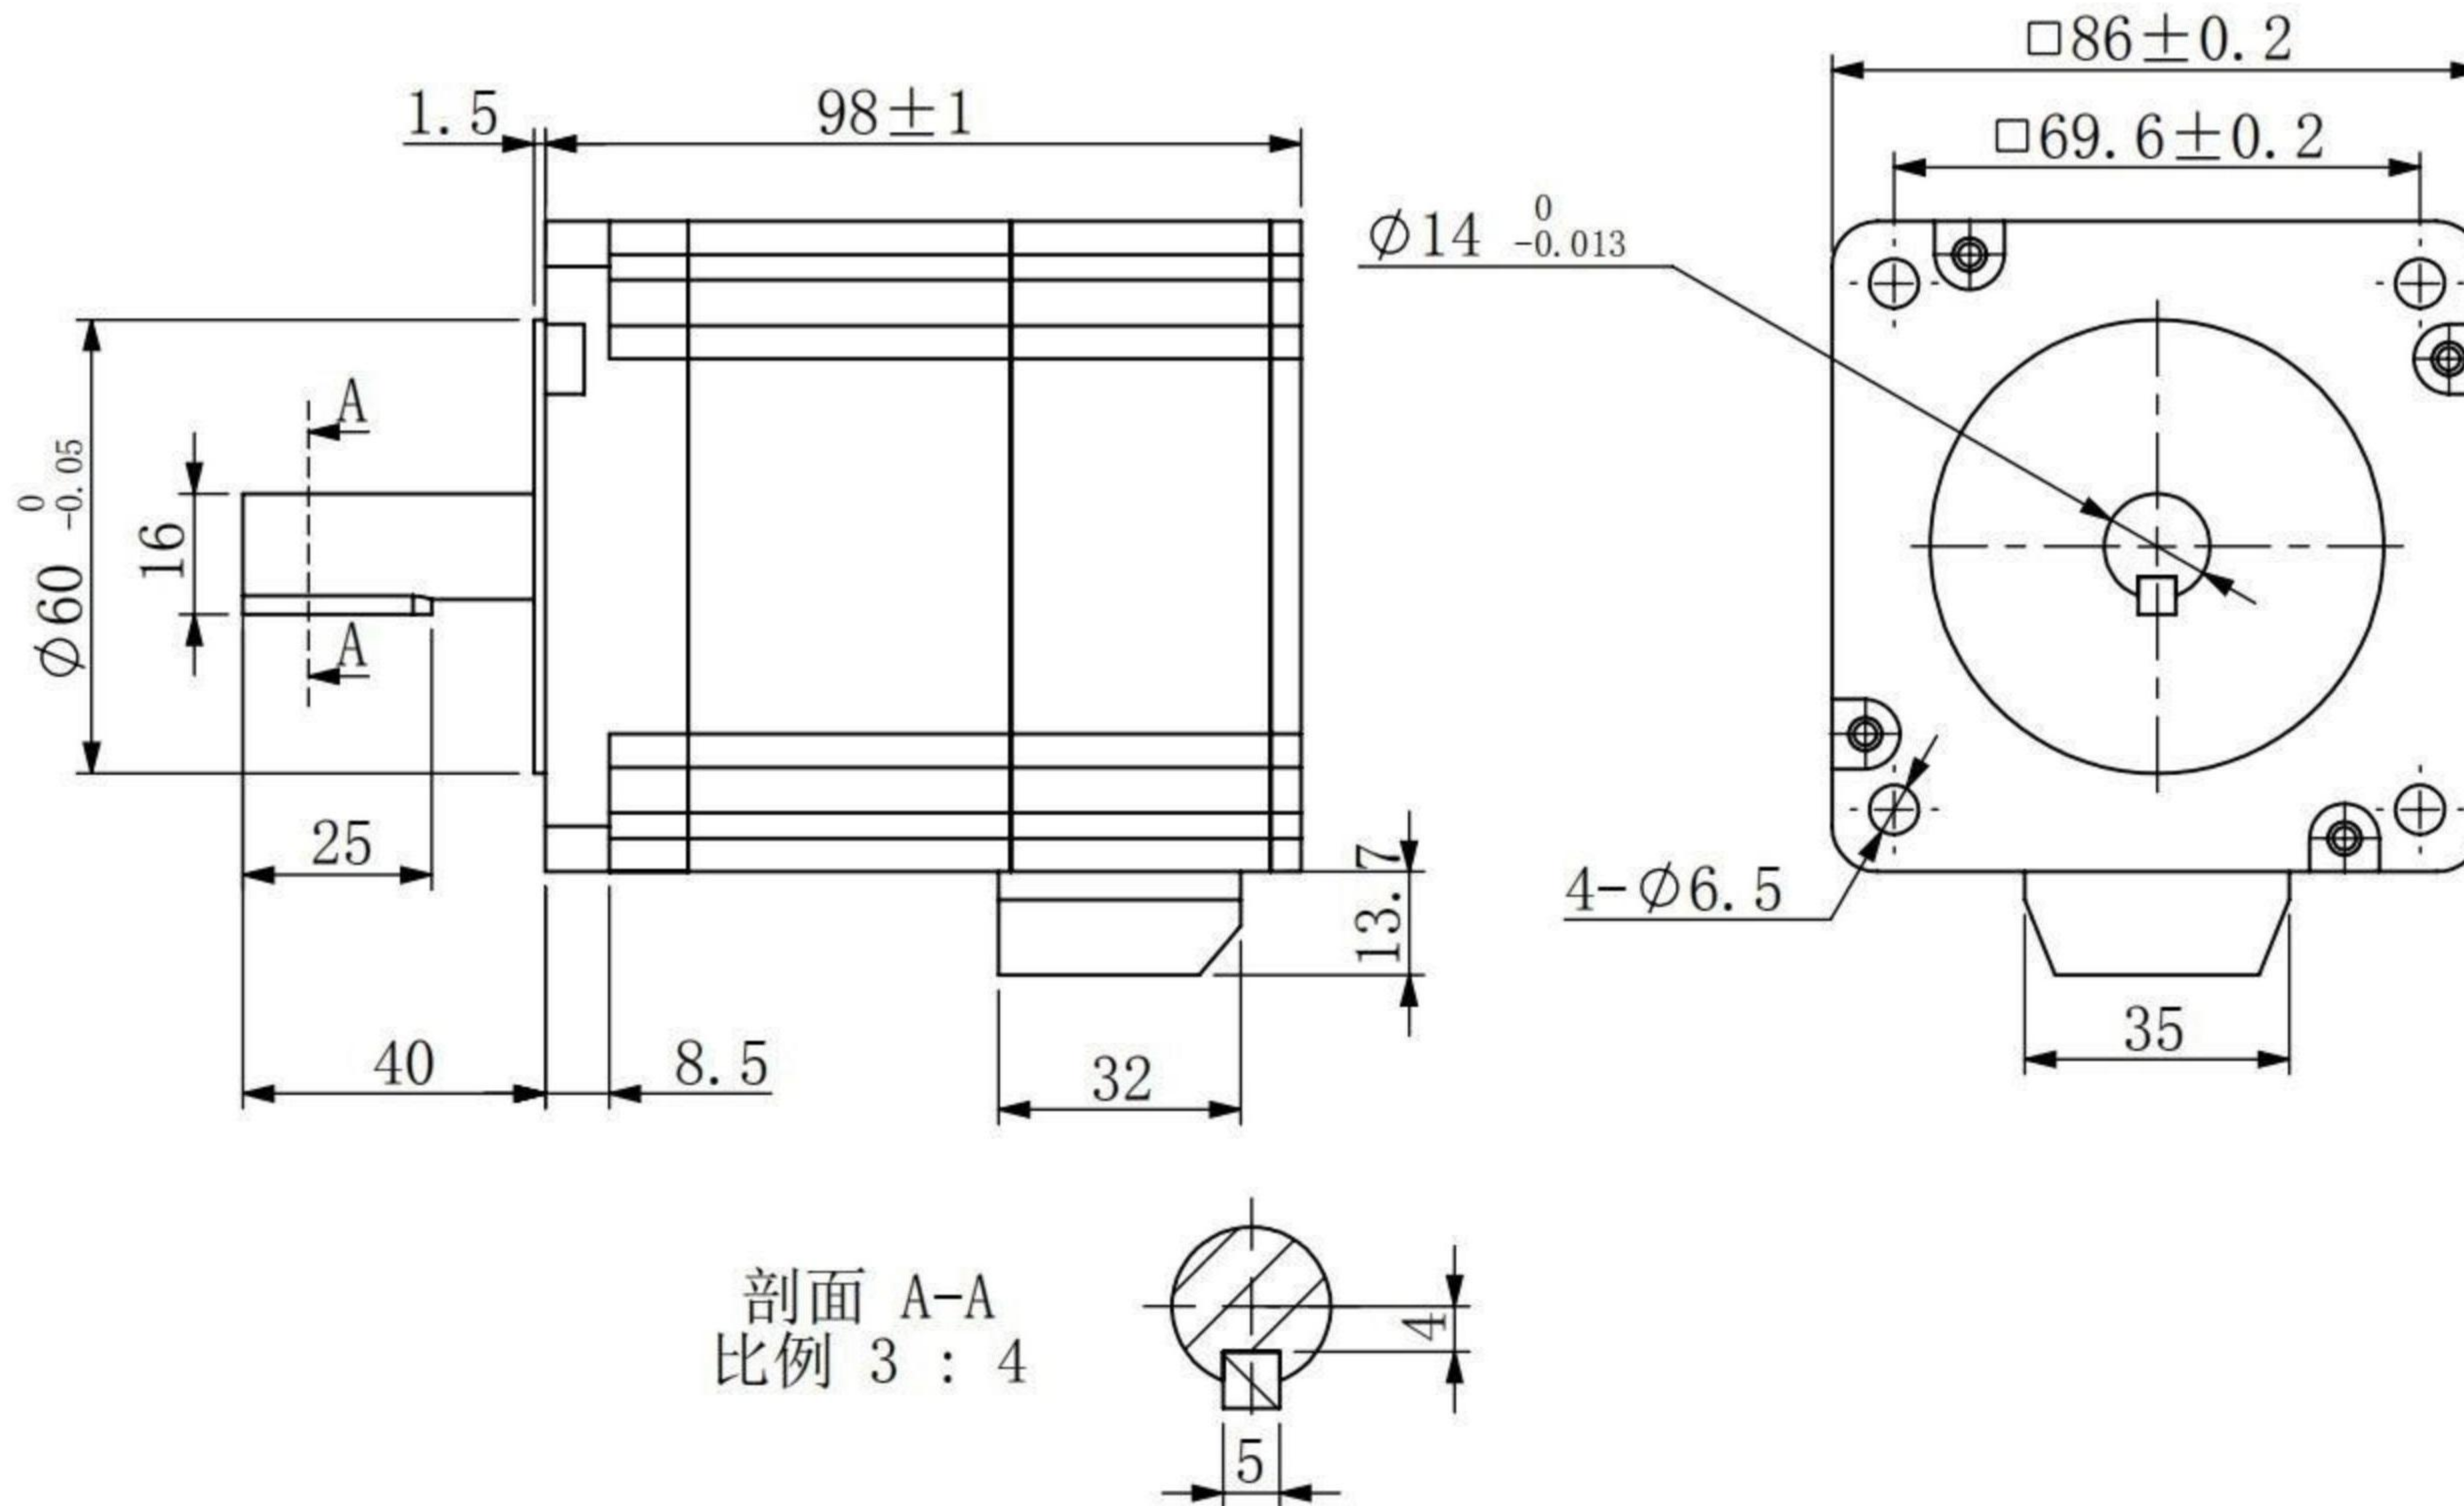

励磁顺序 (2相励磁)
Phase Sequence (2Phase Exciting)


step	A	B	A-	B-
1	+	+	-	-
2	-	+	+	-
3	-	-	+	+
4	+	-	-	+

↑CCW
CW→

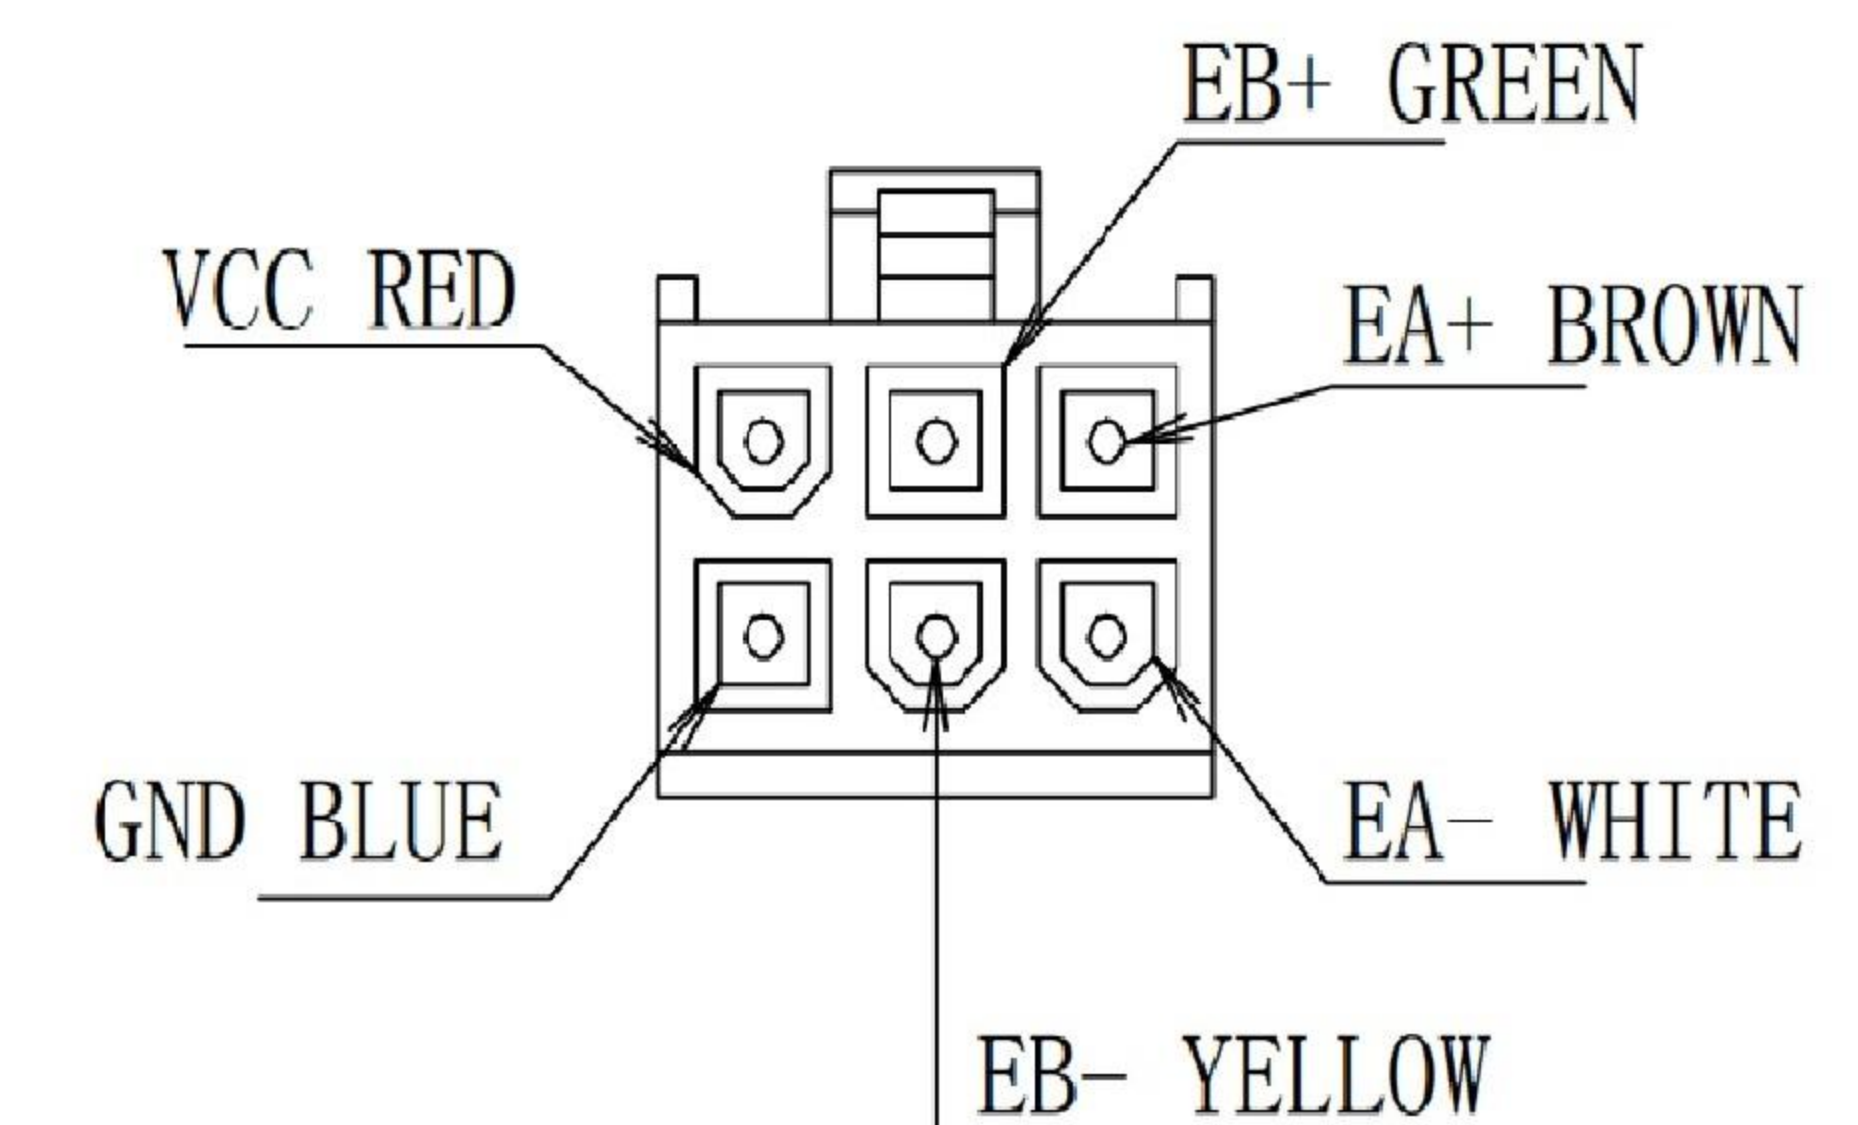

Phase	2	Voltage resistance	500VAC/min
Step angle	1.8°	Insulation resistance	100MΩ /min
Torque	4.5NM	Radial runout	0.06Max (450g-load)
Current	6.0A	Axial runout	0.08Max (450g-load)
Phase inductance	2.8mH	Temperature rise	80°C Max
Phase resistance	0.41Ohm	Ambient Temperature	-10°C ~ +50°C
Rotor inertia	1400g.cm ²	Insulation class	class B

接线图/Wring Diagram

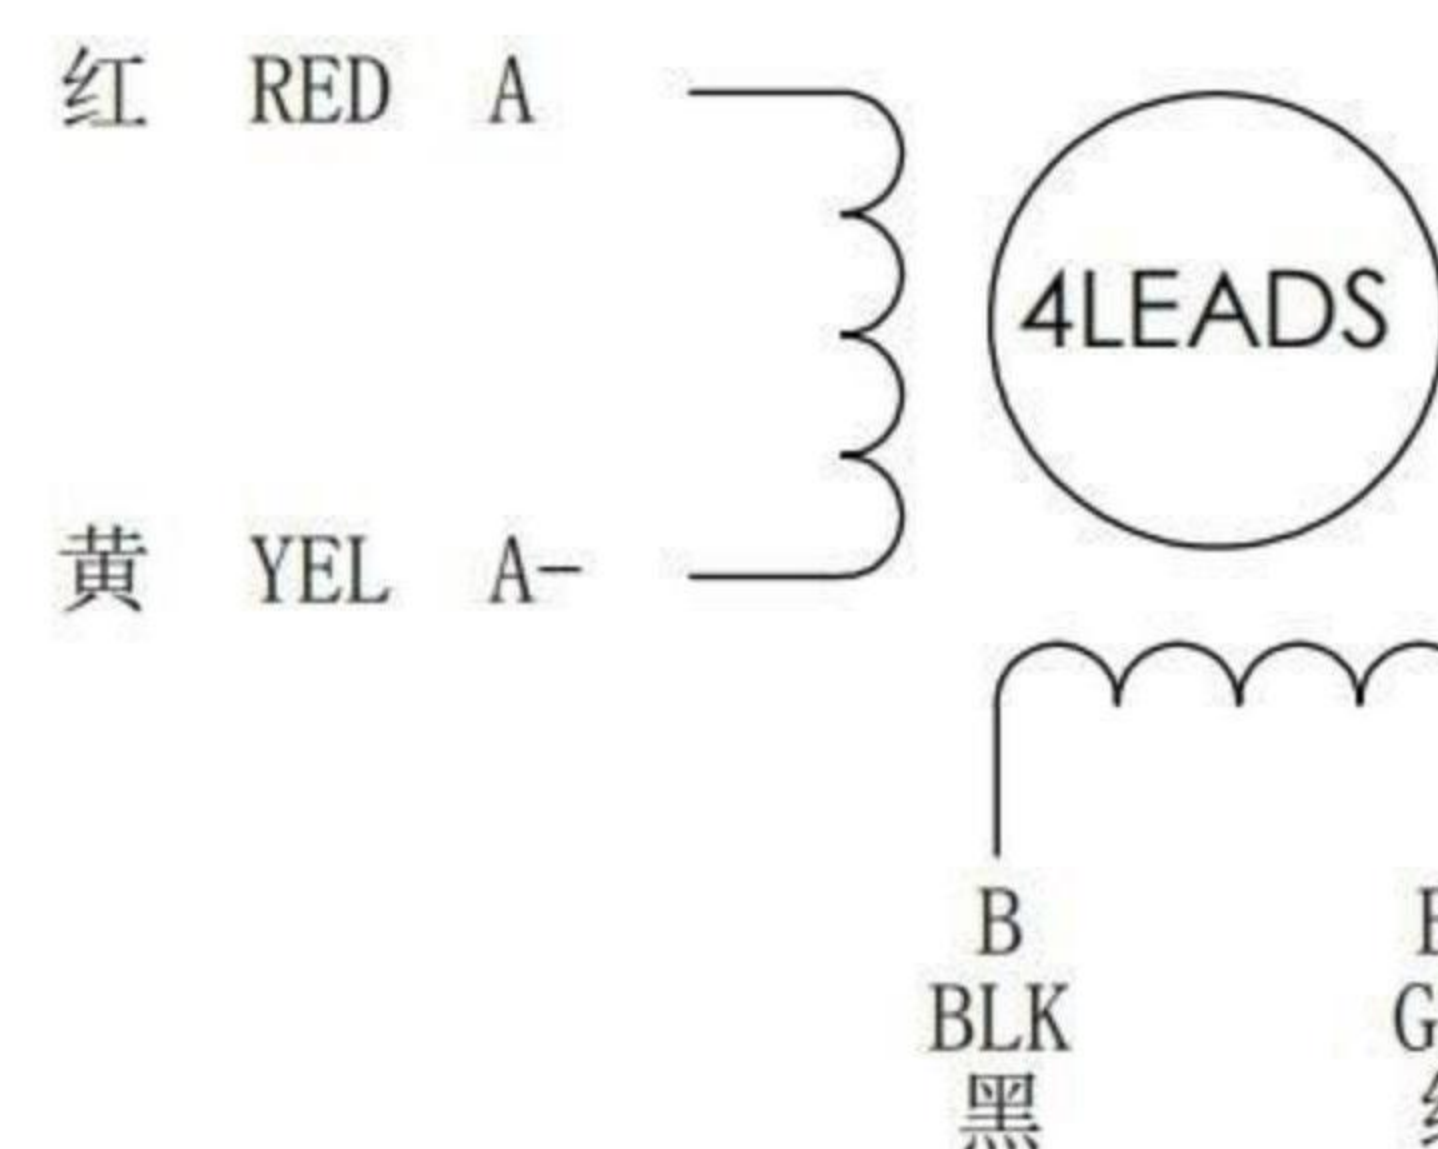

电机引线颜色 Lead Color	棕 BRN	白 WHT	绿 GRN	黄 YEL	红 RED	蓝 BLU	分辨率
信号 Signal	EA+	EA-	EB+	EB-	VCC (+5V)	GND	4000ppr

标题:

深圳锐特机电技术有限公司

工程图号


86A45EC

修订


比例: 1:2

单位: mm

图纸 1 (共1)

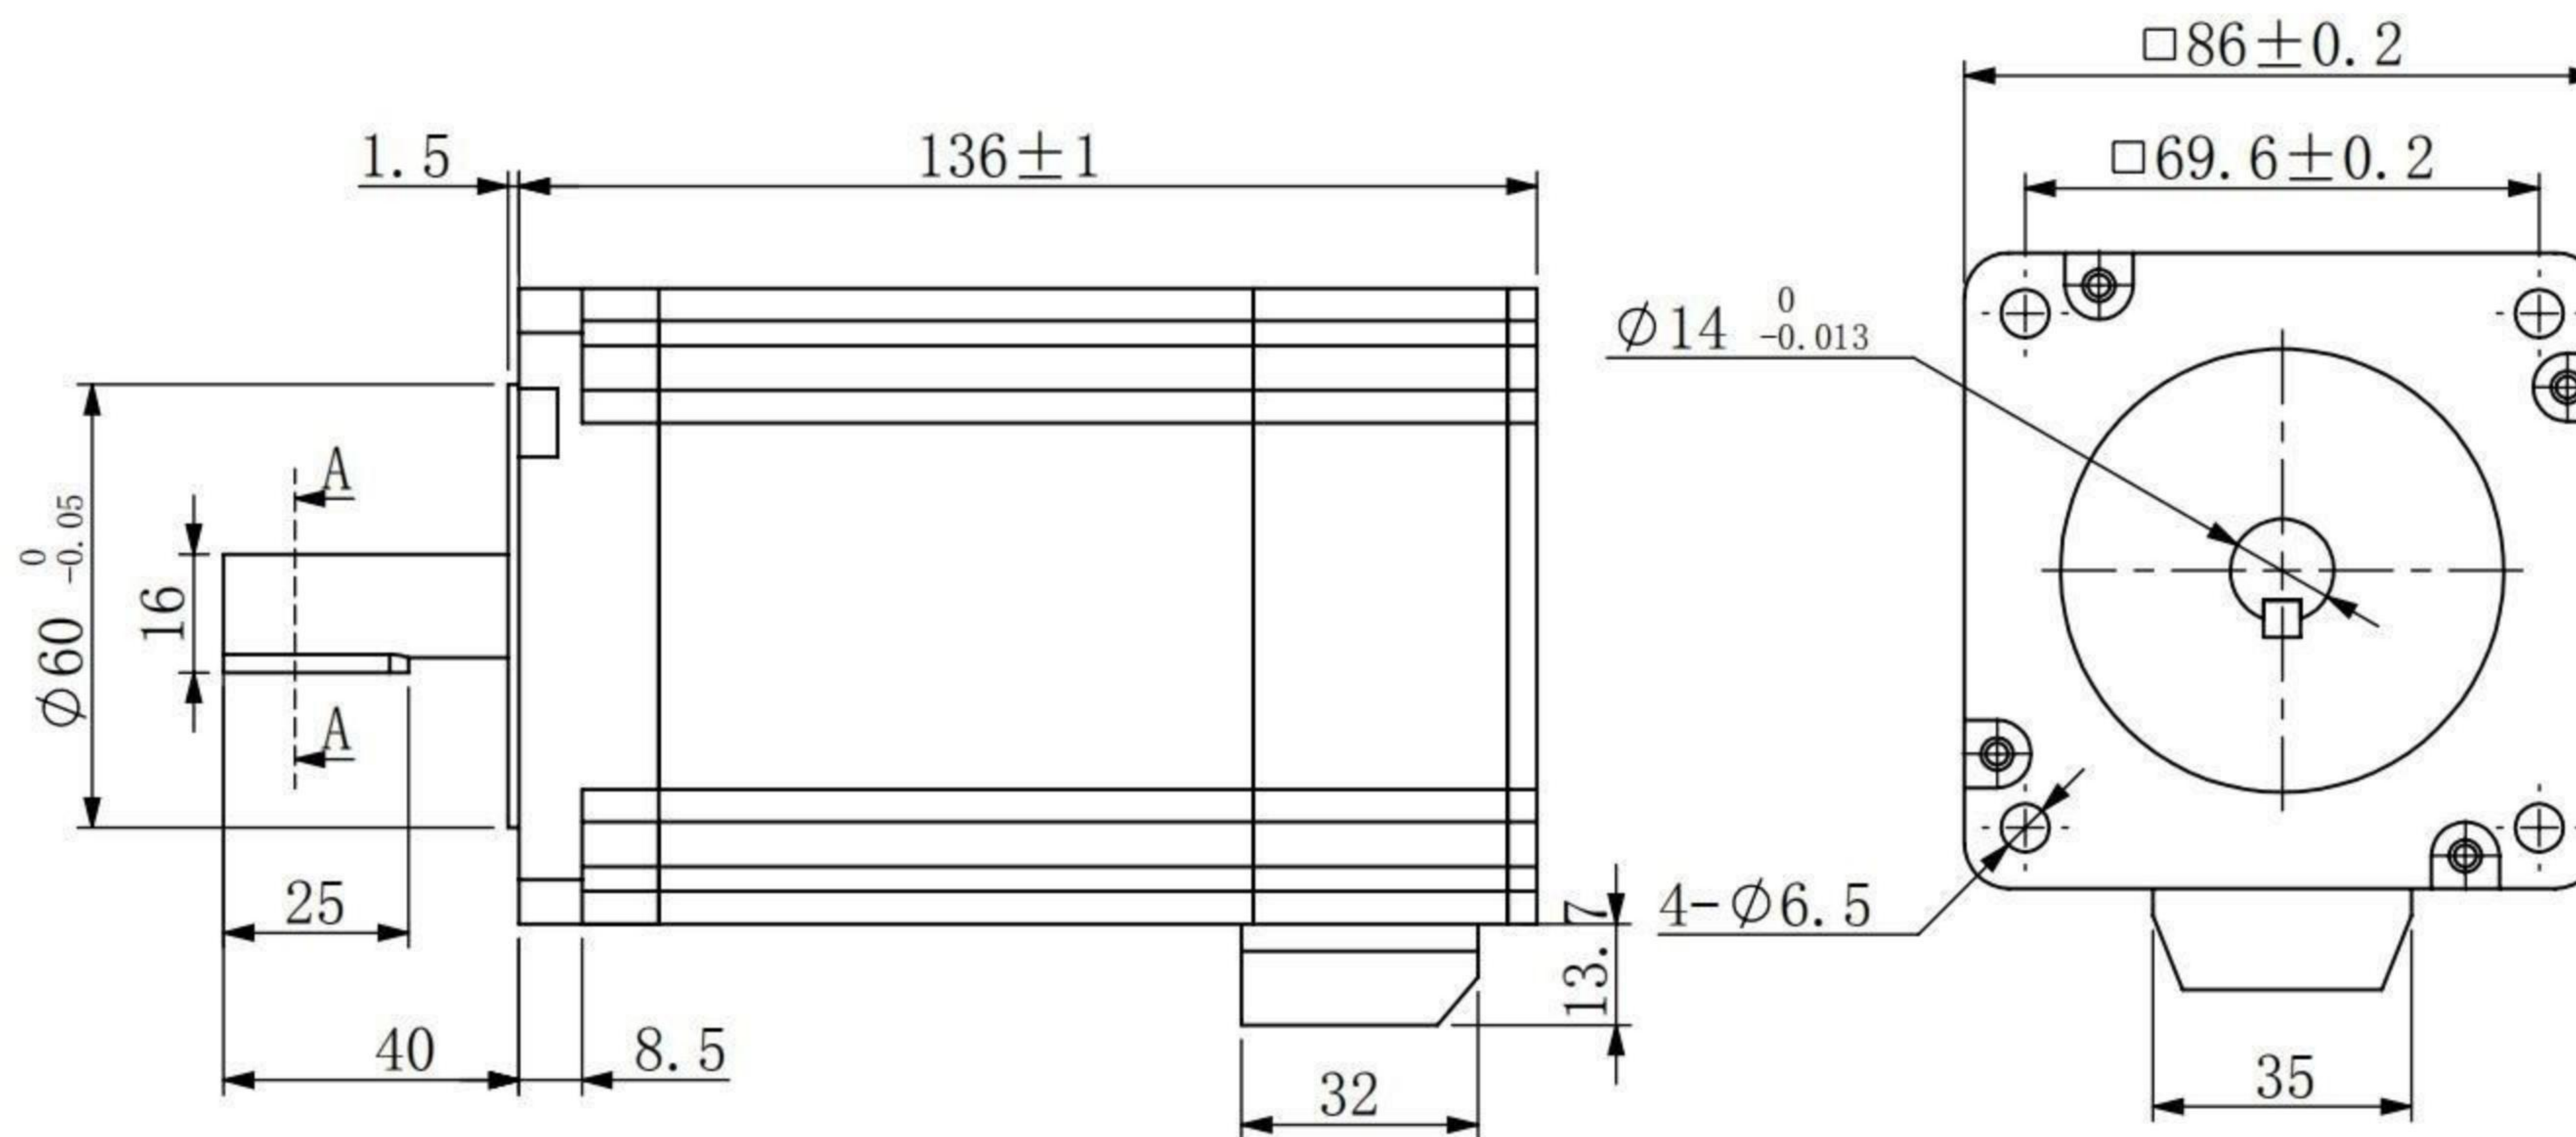


剖面 A-A
比例 3 : 4

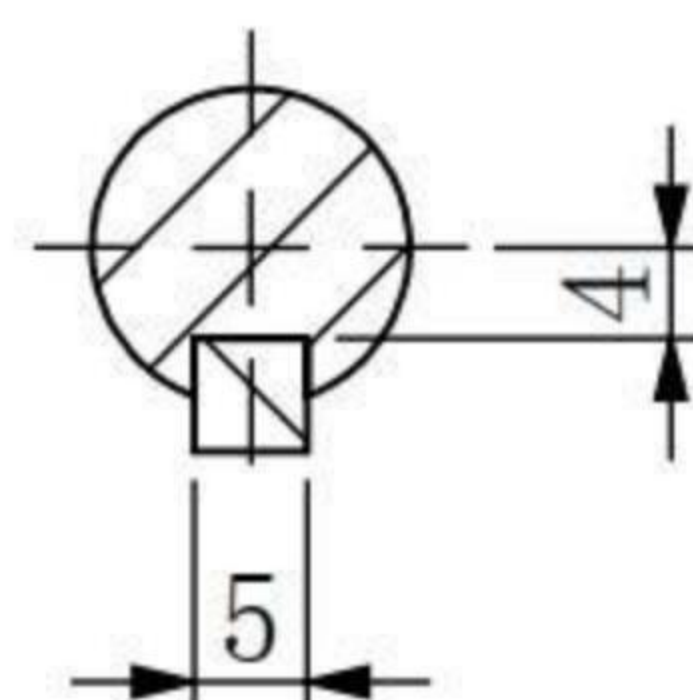

励磁顺序 (2相励磁)
Phase Sequence (2Phase Exciting)


step	A	B	A-	B-
1	+	+	-	-
2	-	+	+	-
3	-	-	+	+
4	+	-	-	+

↑CCW
CW↓

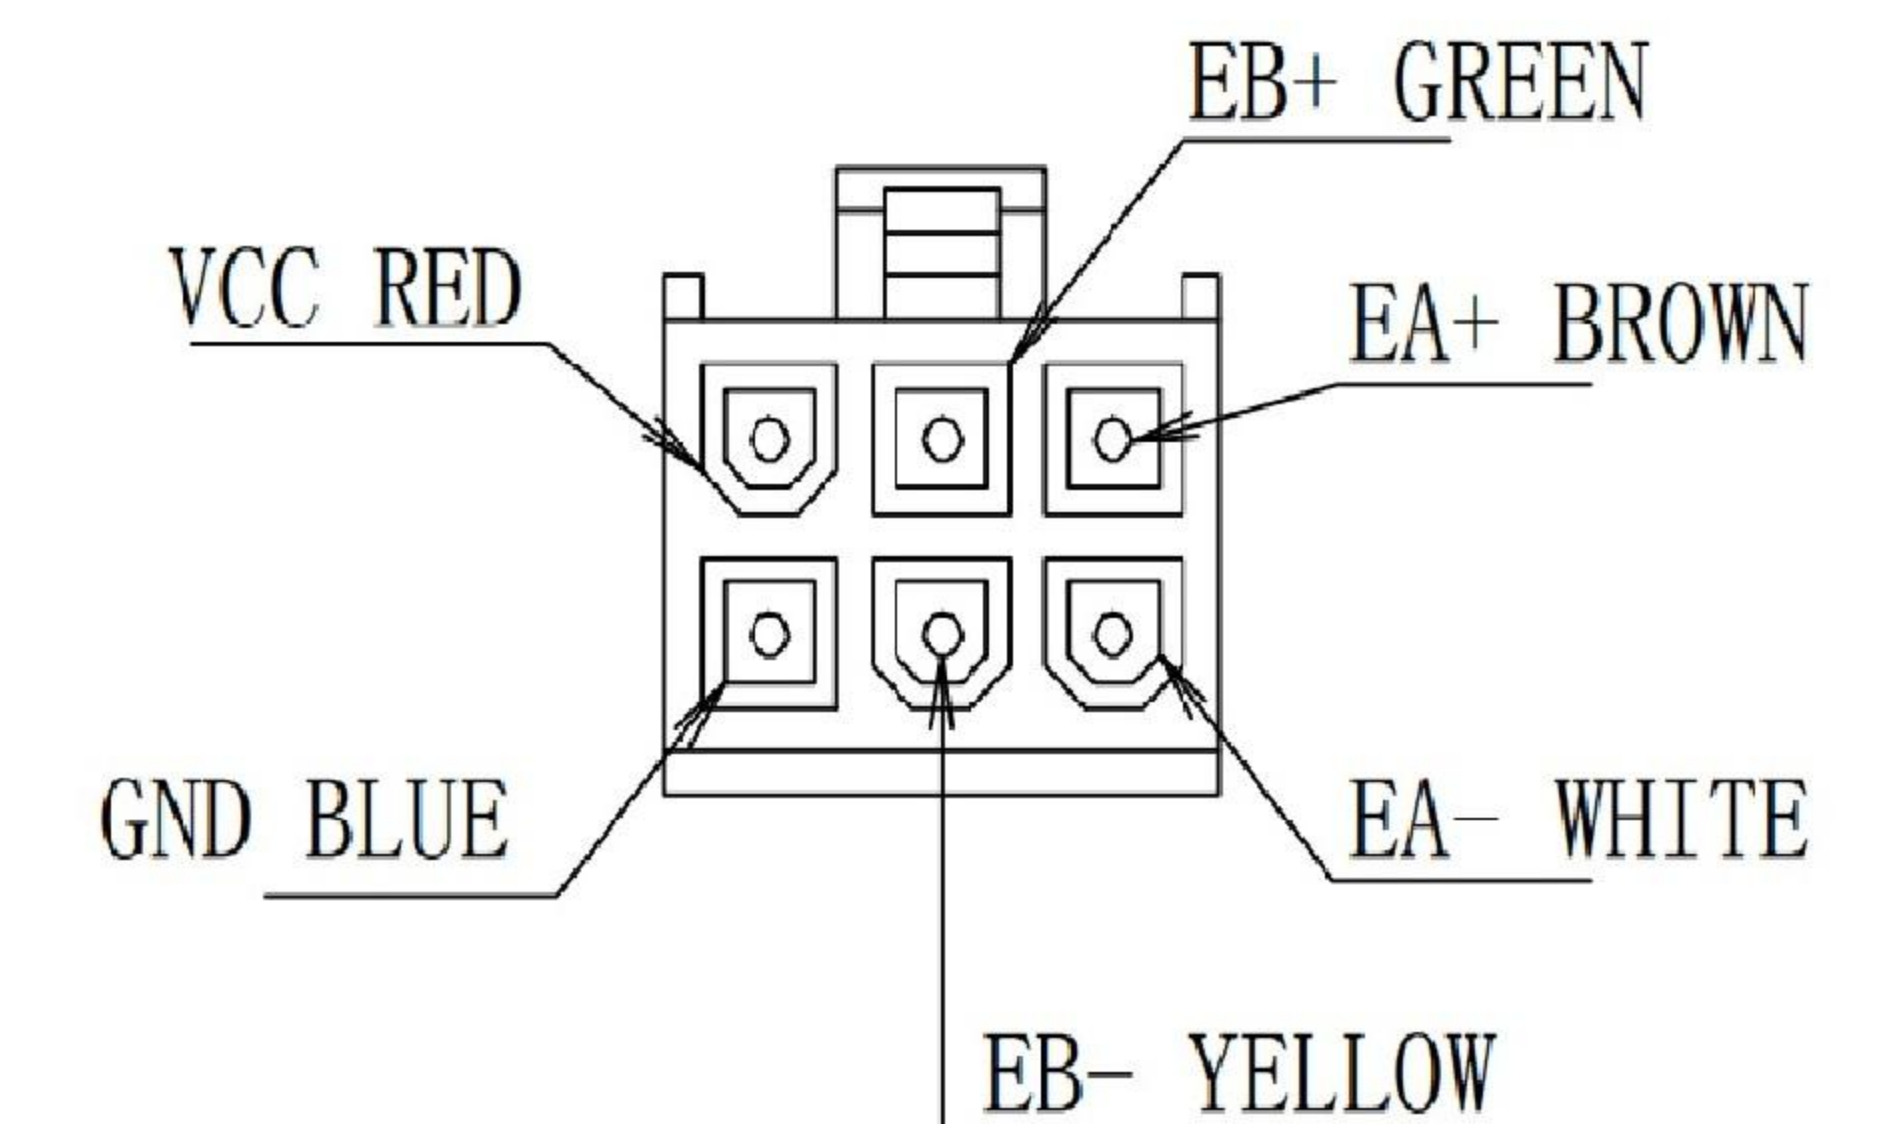

Phase	2	Voltage resistance	500VAC/min
Step angle	1.8°	Insulation resistance	100MΩ /min
Torque	8.5NM	Radial runout	0.06Max (450g-load)
Current	6.0A	Axial runout	0.08Max (450g-load)
Phase inductance	5.5mH	Temperature rise	80°C Max
Phase resistance	0.53Ohm	Ambient Temperature	-10°C ~ +50°C
Rotor inertia	2800g.cm ²	Insulation class	class B

接线图/Wring Diagram

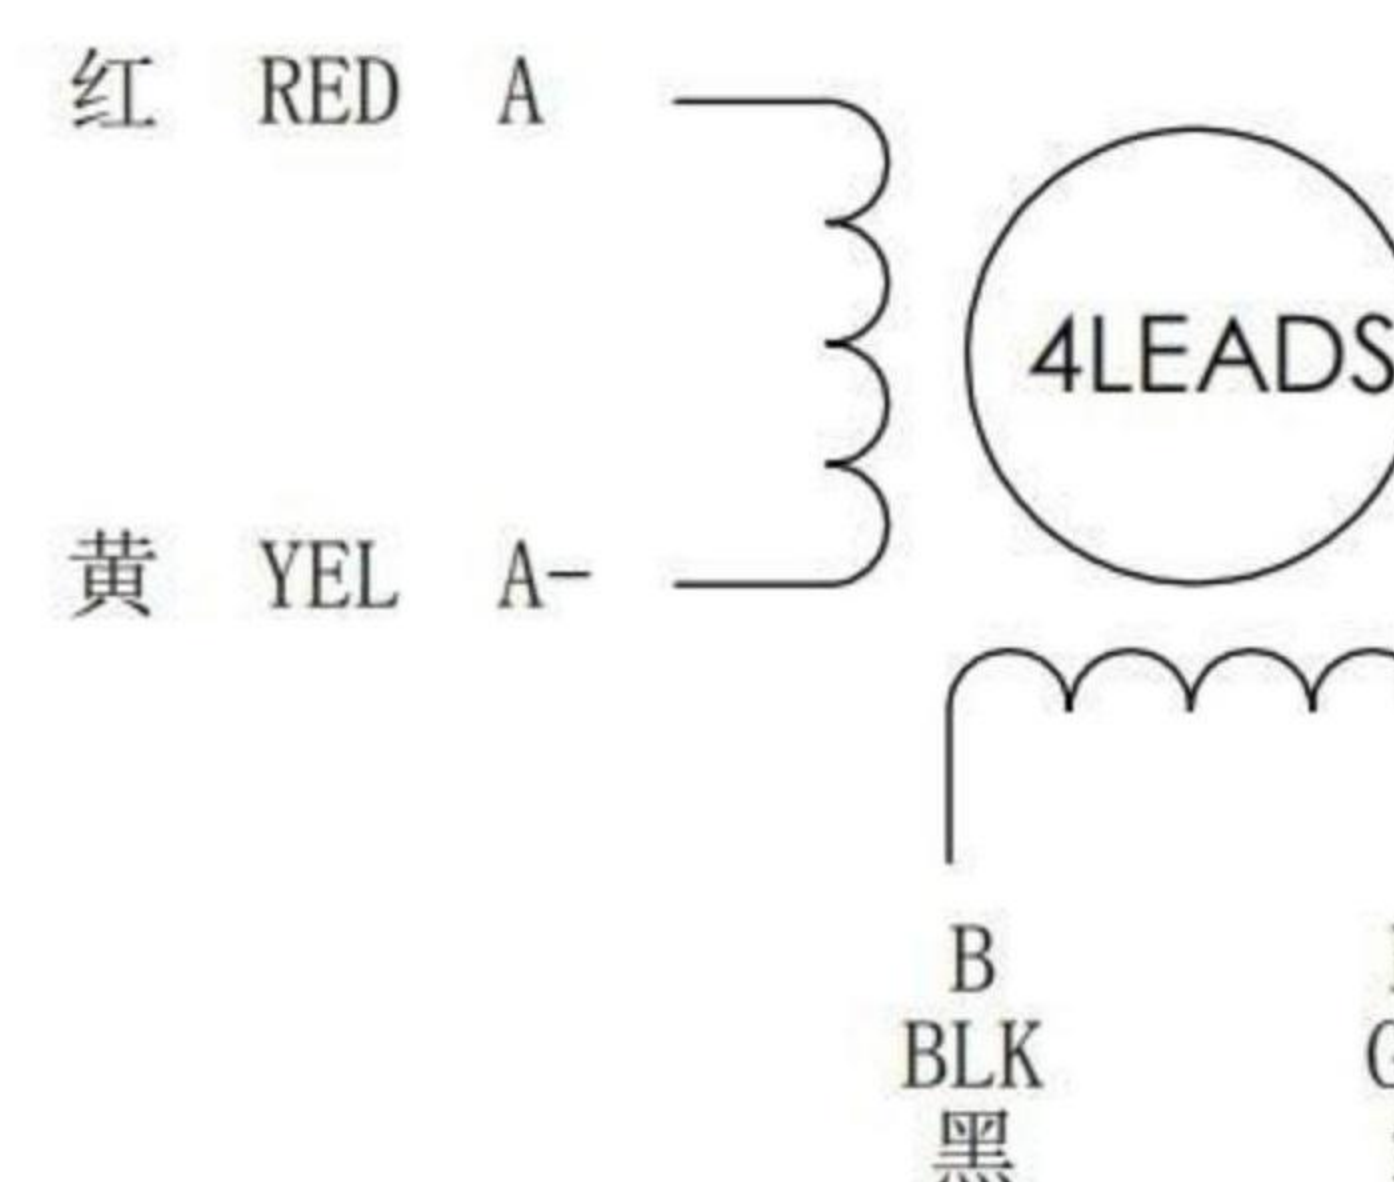

电机引线颜色 Lead Color	棕 BRN	白 WHT	绿 GRN	黄 YEL	红 RED	蓝 BLU	分辨率
信号 Signal	EA+	EA-	EB+	EB-	VCC (+5V)	GND	4000ppr

标题:

深圳锐特机电技术有限公司

工程图号	86A85EC	修订
比例: 1:2	单位: mm	图纸 1 (共1)